

2DM860H Digital Stepper Drive



Manual

Notes:

This driver will not provide one to one stepping ie. (200 steps/rev).
The minimum setting is 400 steps/rev.

When adjusting parameters (dip switches etc.), the power to the driver must be turned off, then on again for changes to take effect.

In order to use signal input voltages higher than 5V, current limiting resistors will be required.
12V = 680ohm 24V=1.8kohm

NEVER put power supply leads onto any other inputs other than VCC and GND. If power leads are not connected properly, permanent damage to the driver will occur.

CAUTION: Be sure to disconnect all power sources when making connections to the driver, motors or breakout boards etc.

Do not install any means of disconnection between the driver and stepper motor.

When mounting driver be sure that the cooling fins are not covered. If mounted in a inclosed box, it will be necessary to add an external fan for heat dissipation.

Always monitor your stepper motors for over heating. If you cannot hold your hand on the motor check for over current and/or over voltage

Contents

1. Overview	4
2. Features	4
3. Ports Introduction	5
3.1 ALM signal output ports	5
3.2 Control Signal Input Ports	6
3.3 Power Interface Ports	7
4. Technological Index	8
5. Connections to Control Signal	9
5.1 Connections to Common Anode	9
5.2 Connections to Common Cathode	10
5.3 Connections to Differential Signal	10
5.4 Connections to 232 Serial Communication Interface	12
5.5 Sequence Chart of Control Signals	12
6. DIP Switch Setting	13
6.1 Activate Edge Setting	13
6.2 Running Direction Setting	14
6.3 Micro steps Setting	14
7. Faults alarm and LED flicker f requency	15
8. Appearance and Installation Dimensions	17
9. Typical Connection	17
10. Parameter Setting	19
11. Processing Methods to Common Problems and Faults	24
11.1 Power on power light off	24
11.2 Power on red alarm light on	24
11. After input pulse signal but the motor not running	25

1. Overview

The 2DM860H is a two phase digital stepper driver based on DSP. Its Micro step resolutions and output current are programmable and it has advanced control algorithm, which can bring a unique level of system smoothness, provides optimum torque and mid range stability. The control algorithm of multi stepping can ensure smooth stepper motor system performance. The control algorithm of torque compensation can improve the torque of motor in the high speed. The control algorithm of motor self test and parameter auto setup technology offers optimum responses with different motors and easy to use. The control algorithm of smoothness can enhance the acceleration and deceleration of motor. Its unique features make the 2DM860H an ideal solution for various applications.


2. Features

- ◆ Parameter auto setup and motor self test
- ◆ Multi-Stepping inside
- ◆ Small noise, low heating, smooth movement
- ◆ Torque compensation in high speed
- ◆ Variable current control technology, High current efficiency
- ◆ Accelerate and decelerate control inside, Great improvement in smoothness of starting or stopping the motor

- ◆ Support PUL/DIR and CW/CCW modes
- ◆ Storage the position of motor
- ◆ Optically isolated input and compatible with 5V or 24V
- ◆ User defined micro steps
- ◆ Microstep resolutions and Output current programmable
- ◆ Over current, over voltage and low voltage protection
- ◆ Green light means running while red light means protection or off line


3. Ports Introduction

3.1 ALM signal output ports

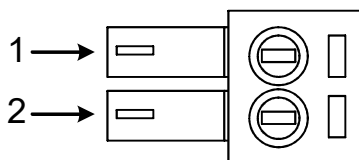

Port	Symbol	Name	Remark
1	ALM+	Alarm output +	
2	ALM-	Alarm output-	


3.2 Control Signal Input Ports

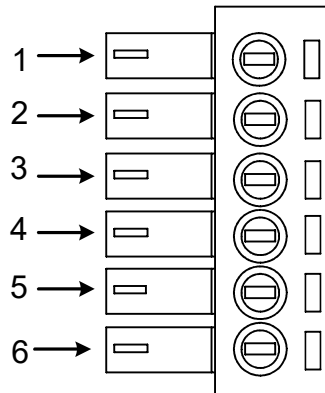

Port	Symbol	Name	Remark
1	DIR-	Direction signal -	Compatible with 5V or 24V
2	DIR+	Direction signal +	
3	PLS-	Pulse signal -	Compatible with 5V or 24V
4	PLS+	Pulse signal +	
5	ENA-	Enable signal -	Compatible with 5V or 24V
6	ENA+	Enable signal +	

In order to use input voltages higher than 5V,
current limiting resistors will be required.
12V = 680ohm 24V=1.8kohm

3.3 Power Interface Ports

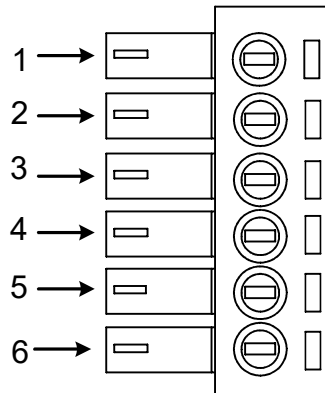

Port	Identification	Symbol	Name	Remark
1	Motor Phase Wire Input Ports	A+	Phase A+	Motor Phase A
2		A-	Phase A -	
3		B+	Phase B+	Motor Phase B
4		B-	Phase B -	
5	Power Input Ports	VCC	Input Power +	AC24V-80V DC30V-110V
6		GND	Input Power -	


NEVER put power supply leads onto any other inputs other than VCC and GND. If power leads are not connected properly, permanent damage to the driver will occur!

4. Technological Index

Input Voltage		24~80VAC 30~110VDC
Output Current		7.5A
Pulse Frequency max		200K
Communication rate		57.6Kbps
Protection		<ul style="list-style-type: none">● Over current peak value 12A±10%● Over voltage value 130V● The over position error range can be set through the HISU
Overall Dimensions(mm)		150 × 97.5 × 53
Weight		Approximate 580g
Specifications	Environment	Avoid dust, oil fog and corrosive gases
	Operating Temperature	+70℃ Max
	Storage Temperature	-20℃ ~+80℃
	Humidity	40~90%RH
	Cooling method	Natural cooling or forced aircooling

5. Connections to Control Signal

5.1 Connections to Common Anode

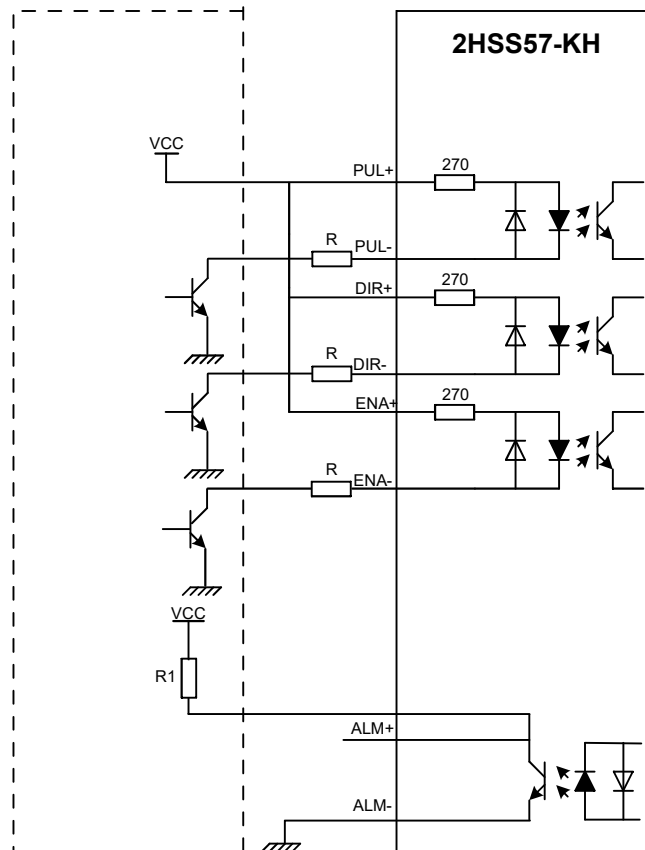


Remark:

VCC is compatible with 5V or 24V;

R(3~5K) must be connected to control signal terminal.

5.2 Connections to Common Cathode

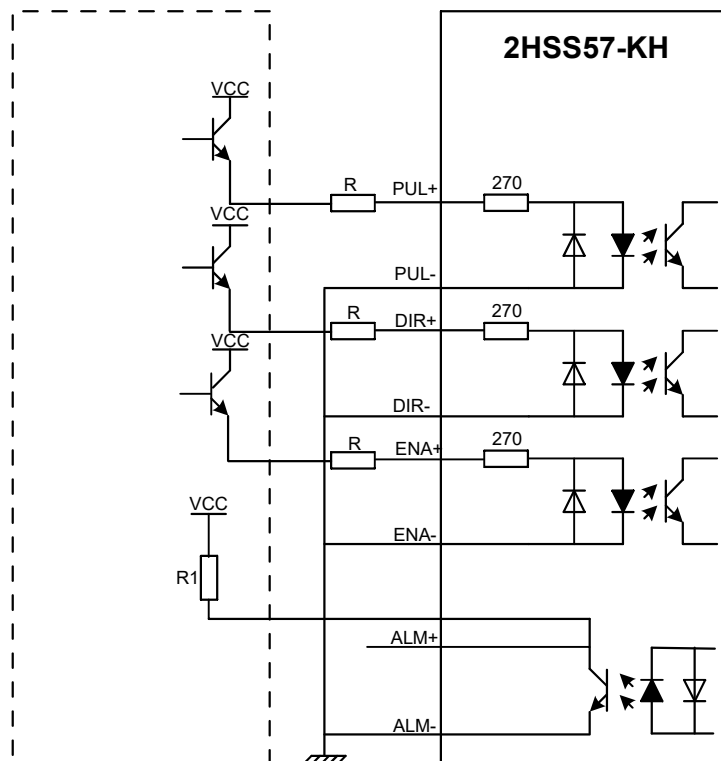


Remark:

VCC is compatible with 5V or 24V;

R(3~5K) must be connected to control signal terminal.

5.3 Connections to Differential Signal

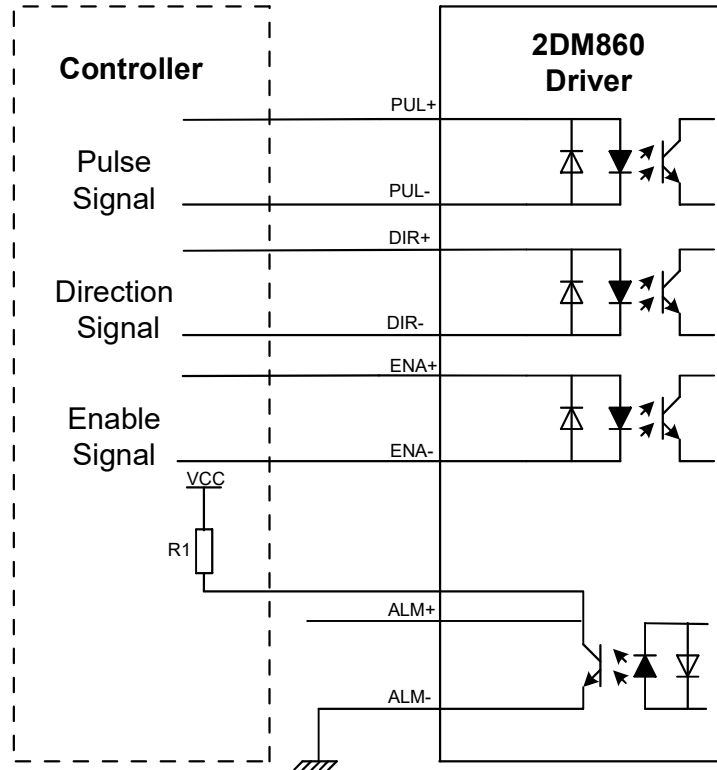


Remark:

VCC is compatible with 5V or 24V;

R(3~5K) must be connected to control signal terminal.


5.4 Connections to 232 Serial Communication Interface

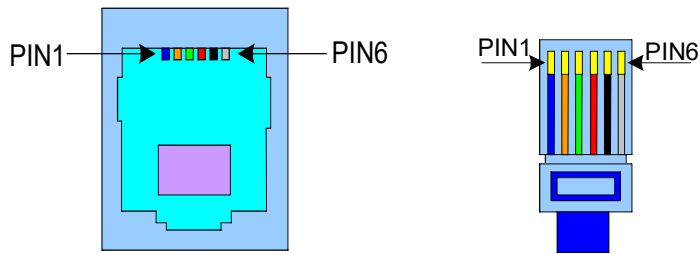

Crystal Head foot	Definition	Remark
1	TXD	Transmit Data
2	RXD	Receive Data
4	+5V	Power Supply to HISU
6	GND	Power Ground

5.5 Sequence Chart of Control Signals

In order to avoid some fault operations and deviations, PUL, DIR and ENA should abide by some rules, shown as following diagram:

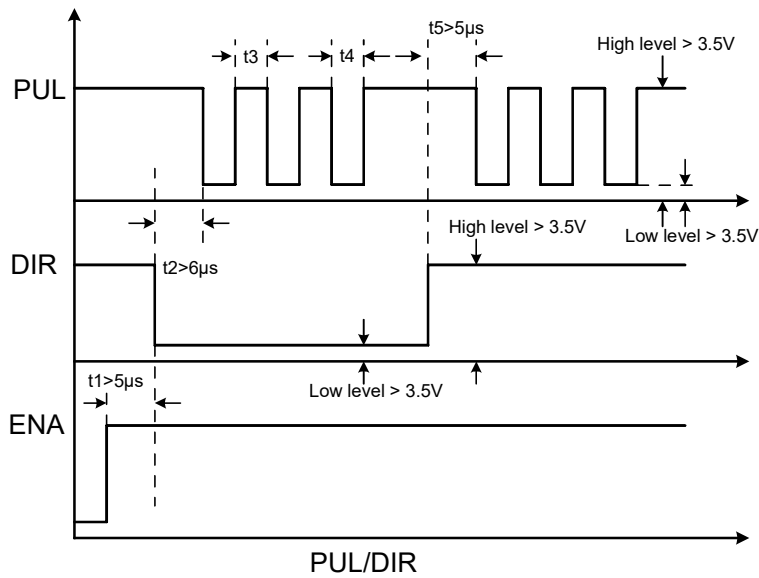

Remark:

- a. t_1 : ENA must be ahead of DIR by at least $5\mu s$. Usually, ENA+ and ENA- are NC (not connected).
- b. t_2 : DIR must be ahead of PUL active edge by $6\mu s$ to ensure correct direction;
- c. t_3 : Pulse width not less than $2.5\mu s$;
- d. t_4 : Low level width not less than $2.5\mu s$.

6. DIP Switch Setting

6.1 Current Setting

The current setting is in the following table.

Dial switch Current		SW1	SW2	SW3
Peak	RMS			
2. 1A	1. 5A	0	0	0
3. 15A	2. 25A	1	0	0
4. 03A	2. 88A	0	1	0
4. 78A	3. 42A	1	1	0
5. 69A	4. 06A	0	0	1
6. 44A	4. 60A	1	0	1
7. 35A	5. 25A	0	1	1
8. 4A	6. 0A	1	1	1

6.2 Standstill current Setting

SW4 is used for setting the standstill current “off”, means the standstill current is set to be half of the selected dynamic current or other current, which can be set by the HISU, the details can be seen in the tenth sections. while “on” means the standstill current is set to be the same as the selected dynamic current.


6.3 Micro steps Setting

The micro steps setting is in the following table. And the micro steps can be also setting through the HISU. The details can be seen in the tenth

sections.


Dial switch Micro steps	SW5	SW6	SW7	SW8
400	1	1	1	1
800	0	1	1	1
1600	1	0	1	1
3200	0	0	1	1
6400	1	1	0	1
12800	0	1	0	1
25600	1	0	0	1
51200	0	0	0	1
1000	1	1	1	0
2000	0	1	1	0
4000	1	0	1	0
5000	0	0	1	0
8000	1	1	0	0
10000	0	1	0	0
20000	1	0	0	0
40000	0	0	0	0

7. Faults alarm and LED flicker frequency

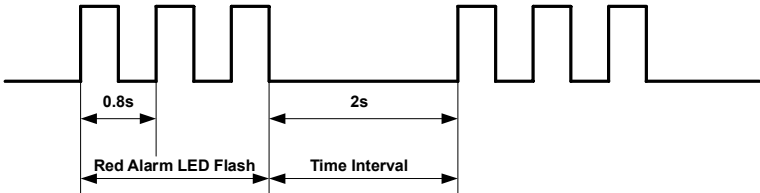


Flicker Frequency	Description to the Faults
1	Error occurs when the motor coil current exceeds the drives current limit.
2	Voltage reference error in the drive
3	Parameters upload error in the drive
4	Error occurs when the input voltage exceeds the drive's voltage limit.

8. Appearance and Installation Dimensions

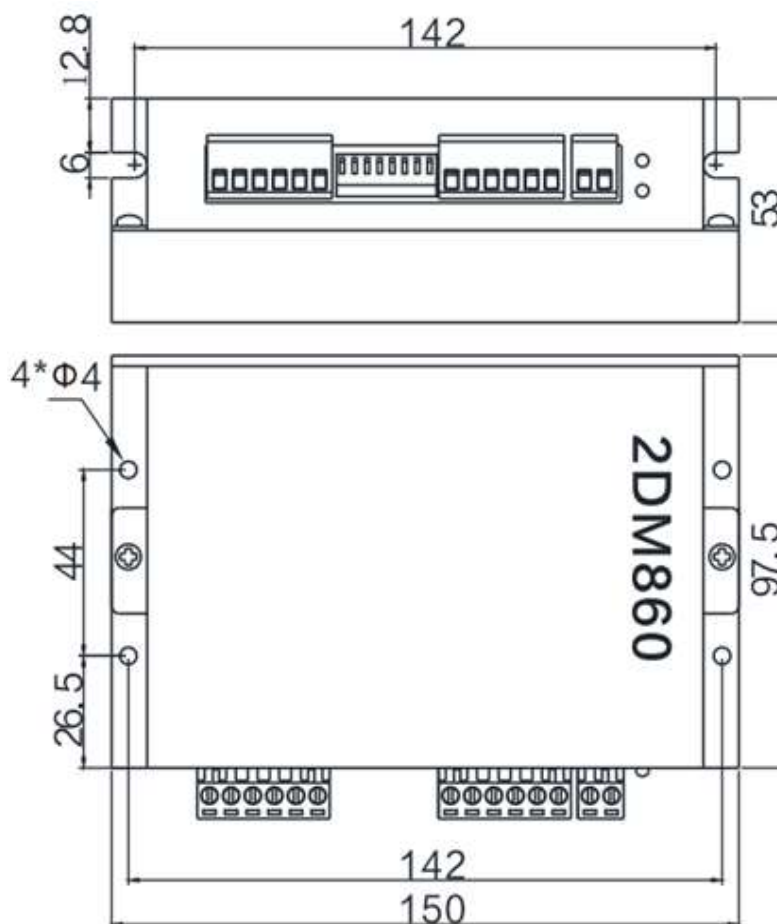

9. Typical Connection

Here is the typical connection of 2DM860

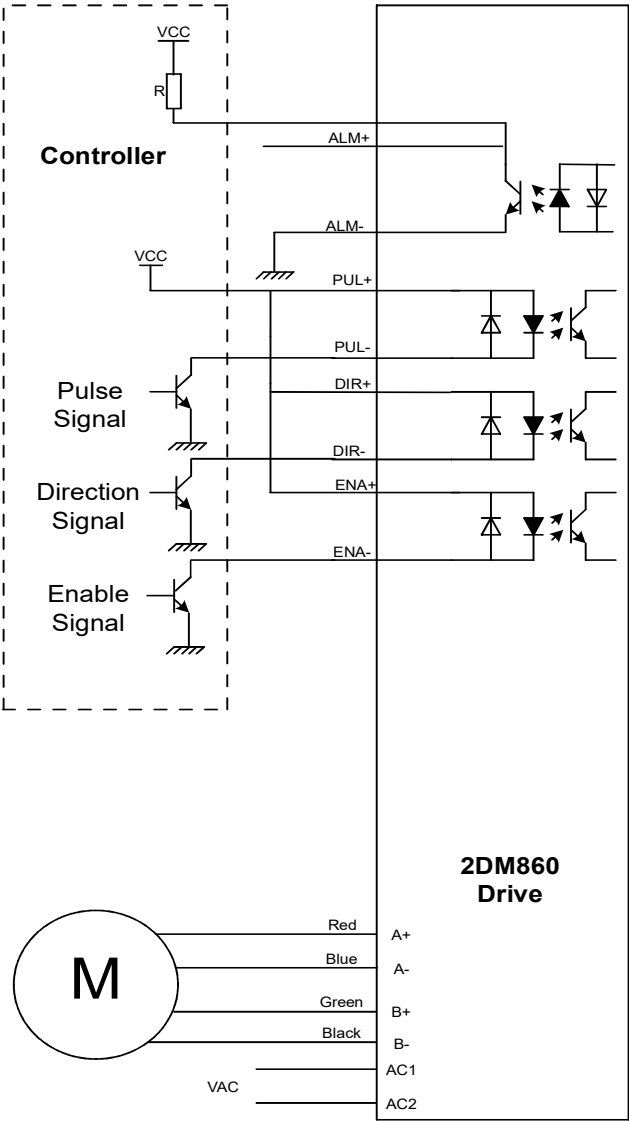

10. Parameter Setting

The parameter setting method of 2DM860 drive is to use a HISU adjuster through the 232 serial communication ports, only in this way we can set the parameters we want. There are a set of best default parameters to the corresponding motor which are carefully adjusted by our engineers, users only need refer to the following table, specific condition and set the correct parameters.

Actual value = Set value × the corresponding dimension

Mode	Definition	Range	Dimension	Drive Restart	Default Value
P1	Current loop Kp	0—4000	1	Y	4000
P2	Current loop Ki	0—1000	1	Y	100
P3	Damping coefficient	0—500	1	N	100
P4	Amplitude of first resonance point	0—100	1	N	0
P5	Phase of first resonance point	0—100	1	N	0
P6	Amplitude of second resonance point	0—100	1	N	0
P7	Phase of second resonance point	0—100	1	N	0
P8	Anti-resonance coefficient	0—100	1	N	0
P9	Reserved				
P10	Enable signal level	0—1	1	N	1
P11	Edge of the pulse	0—1	1	N	1


P12	Reserved				
P13	Command Type	0—1	1	N	0
P14	User defined micro steps	4—1000	50	Y	0
P15	Time of standstill current	0—4000	1ms	Y	1000
P16	Percentage of standstill current	0—100	1	Y	50
P17	Speed smoothness	0—10	1	Y	0
P18	Enable of position memory	0—1	1	Y	0
P19	User defined resistance of motor	0—100	mh	Y	0
P20	User defined inductance of motor	0—100	0.1ohm	Y	0
P21	Result of position memory	0—128	1		0
P22	Time of enable position memory	0—100	1s	Y	5

There are total 22 parameter configurations, use the HISU to download the configured parameters to the drive, the detail descriptions to every parameter configuration are as follows:

Item	Description
Current loop Kp	Increase Kp to make current rise fast. Proportional Gain determines the response of the drive to setting

	command. Low Proportional Gain provides a stable system (doesn't oscillate), has low stiffness, and the current error, causing poor performances in tracking current setting command in each step. Too large proportional gain values will cause oscillations and unstable system.
Current loop Ki	Adjust Ki to reduce the steady error. Integral Gain helps the drive to overcome static current errors. A low or zero value for Integral Gain may have current errors at rest. Increasing the integral gain can reduce the error. If the Integral Gain is too large, the system may hunt (oscillate) around the desired position.
Damping coefficient	This parameter is used to change the damping coefficient in case of the desired operating state is under resonance frequency. This parameter is useful in high speed.
Amp1—3	2DM860 Driver provides robust antiresonance control to stop the vibrations and maintain equilibrium.
Phase1—3	Amp1 and Phase1 is Phase adjustment for 1st and Amplitude adjustment for 1st resonance area respectively. Usually between 0.6rps and 1.2rps.

	Amp2 and Phase2 is Phase adjustment for 2nd and Amplitude adjustment for 2nd resonance area respectively. Usually between 1.2rps and 2.4rps.
Anti-resonance coefficient	This parameter is used for reducing resonance. Usually between 3rps and 4rps.
Enable signal level	This parameter is set to control the Enable input signal level. 0 means low, while 1 means high.
Edge of the pulse	This parameter is set to choice the edge of the input pulse. 0 means rising edge, while 1 means falling edge.
Command Type	This parameter is set to choice the PUL/DIR mode or CW/CCW mode. 0 means PUL/DIR mode, while means CW/CCW mode. When choice the CW/CCW mode, should make sure the port which don't input PUL is low level.
User-defined micro steps	This parameter is set of user defined micro steps The actual micro steps = the set value \times 50. For example, if the parameter is 4, the micro steps is $4 \times 50 = 800$. But If this parameter is 0, which means micro steps is set by the outer DIP switches.
Time of	This parameter is set the time when the standstill

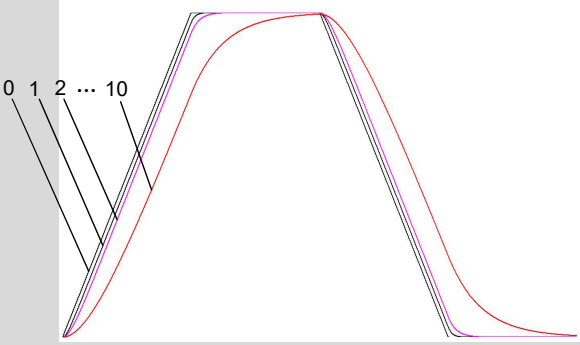standstill current	current is set to be half of the selected dynamic current or other current,
Percentage of standstill current	This parameter is set the percentage of standstill current.
Speed smoothness	<p>This parameter is set to control the smoothness of the speed of the motor while acceleration or deceleration, the larger the value, the smoother the speed in acceleration or deceleration</p> 
Enable of position memory	This parameter is set to enable the function of position memory. 0 means disable, while 1 means enable. If set 1, the 2DM860 can remember the position of motor in the next time of power on.
User -defined resistance of motor	This parameter is set the resistance of motor. 0 means 2DM860 gets the resistance by control algorithm of Parameter auto setup, while 1 means 2DM860 gets the resistance through user sets.

User-defined inductance of motor	This parameter is set the inductance of motor. 0 means 2DM860 gets the inductance by control algorithm of Parameter auto setup, while 1 means 2DM860 gets the inductance through user sets.
Result of position memory	This parameter is set to control the smoothness of Display the result of position memory
Time of enable position memory	This parameter is set of the time when enable the position memory. The time is mean the space of time to stop plus input.

11. Processing Methods to Common Problems and Faults

11.1 Power on power light off

- No power input, please check the power supply circuit. The voltage is too low.

11.2 Power on red alarm light on

- Please check the motor is connected with the drive.
- The stepper digital drive is over voltage or under voltage. Please lower or increase the input voltage.

11.4 After input pulse signal but the motor not running

- Please check the input pulse signal wires are connected in reliable way.
- Please make sure the input pulse mode is corresponding with the real input mode.
- The Driver is disabled